

CONFIDENTIAL

MG/221

SERVICE MEMORANDUM

21 May 1958

INSUFFICIENT DOOR OPENING

MGA COUPE

Complaints of this nature may be dealt with by removing the door hinges and reducing the stops on the bosses to allow the door to open to approximately 25" (635 mm.), measured from the rear door pillar to the extreme end of the door.

Care should be taken not to remove too much metal, otherwise the door flange will foul the hinge pillars when opened.

The above applies to early models only. Present production has been suitably modified.